



AN ISO 9001 CO.

SURI INTERNATIONAL



www.sp-groupindia.com

Brake Lining

Replacement parts
Catalogue **2024**

ੴ ਸਤਿਗੁਰ ਪ੍ਰਸਾਦਿ

ਸਚਹੁ ਓਰੈ ਸਭੁ ਕੋ ਓਪਰਿ ਸਚੁ ਆਚਾਰੁ।।

ਗੁਰੂ ਨਾਨਕ

**TRUTH IS THE HIGHEST VIRTUE
BUT HIGHER STILL IS TRUTHFULL LIVING
GURU NANAK**

SI No.	Rep To.	Application	Page No.	SI No.	Rep To.	Application	Page No.
BL0150	15150	IVECO STEYR	2	BL0580	19579	Bova, MAN, Mercedes-Benz, Neoplan	7
BL0174	15174	IVECO STEYR	2	BL0581	19580	Bova, MAN, Mercedes-Benz, Neoplan	7
BL0059	17059	MERCEDES BENZ, Bussing, Tata	2	BL0582	19581	Bova, MAN, Mercedes-Benz, Neoplan	7
BL0161	17161	SCANIA	2	BL0591	19582	Bova, MAN, Mercedes-Benz, Neoplan	7
BL0276	17276	MERCEDES BENZ	2	BL0604	19591	BPW	7
BL0683	17683	M.A.N., MERCEDES BENZ	3	BL0605	19604	Fruehauf, Meritor	7
BL0743	17742	SETRA SERIES 300	8	BL0606	19605	Fruehauf, Meritor	7
BL0790	17743	SETRA SERIES 300	8	BL0613	19606	Foden, Fruehauf, SAE, SAF, SMB, Trailor	7
BL0796	17795	MERCE O 303	8	BL0614	19613	Fruehauf, SMB, Trailor	7
BL0799	17796	MERCE O 303	8	BL0617	19614	Fruehauf, SMB, Trailor	7
BL0030	19030	R.O.R. (MERITOR)	1	BL0618	19617	DAF F2800, DAF F3300, DAF F3600	7
BL0032	19032	MERCEDES BENZ	1	BL0632	19618	DAF F2800, DAF F3300, DAF F3600	7
BL1032	19032	Styler, B. P. W Axle, Cardi, Warstein	4	BL0633	19632	Mercedes-Benz	7
BL0033	19033	Bergische Achsen (B. P. W)	1	BL0694	19633	Mercedes-Benz	7
BL1033	19033	R.O.R. (MERITOR)	4	BL0699	19694	FIAT, IVECO LKW	7
BL0036	19036	BODEN, CARRIMORE, FRUEHAUF	1	BL0714	19699	BOVA FUTURA FHD, MERCE CONECTO, NEOPL CITYLINER, NEOPL JETLINER, NEOPL	8
BL0037	19037	FREMCO, HANDS, HIGHWAY, YORK	2	BL0716	19714	Iveco	8
BL0075	19075	SCANIA	2	BL0718	19716	ERF, Iveco, Meritor	8
BL0094	19094	KASSBOHRER / MERRIWORTH TRAILERS	2	BL0720	19718	Fruehauf, Benalu, SMBF	8
BL0121	19112	Mercedes-Benz	5	BL0800	19719	Fruehauf, Benalu, SMBF	8
BL0185	19121	BPW 420 X 180	5	BL0721	19720	Raba	8
BL0112	19150	D.A.F	5	BL0722	19721	Raba	8
BL0151	19151	D.A.F	2	BL0742	19722	Raba	8
BL0160	19160	MERCEDES BENZ	2	BL0791	19790	Fruehauf	8
BL0200	19185	MAN 13215	5	BL0795	19791	Fruehauf	8
BL0187	19187	RENAULT, R.V.I	2	BL0780	19799	Volvo	8
BL0256	19200	BPW, Cardi, Fruehauf, SAE, SAF	5	BL0825	19800	Volvo	8
BL0245	19245	Steyr puch (Daimler)	2	BL0814	19814	NISSAN UD	3
BL0246	19246	Steyr puch (Daimler)	2	BL0844	19844	Mercedes-Benz	9
BL0260	19256	Bova, DAF, Neoplan	5	BL0845	19845	Mercedes-Benz	9
BL0351	19260	Bova, DAF, Neoplan	5	BL0848	19847	Neoplan, Perrot, Setra, Van Hool	9
BL0283	19283	SAUER / SAF	2	BL0877	19850	Neoplan, Perrot, Setra	9
BL0284	19284	SAUER / SAF	2	BL0878	19877	PEGAS TRONER 1236.38T	9
BL0365	19351	Bedford, Ford, Renault	5	BL0879	19878	PEGAS TRONER 1236.38T	9
BL0366	19365	Fruehauf, Meritor	5	BL0881	19879	PEGAS TRONER 1334 R	9
BL0371	19366	Fruehauf, Meritor	5	BL0885	19881	PEGAS TRONER 1334 R	9
BL0369	19369	BODEN TRAILAR	2	BL0886	19885	Volvo	9
BL0370	19370	BODEN TRAILAR	3	BL0887	19886	Volvo	9
BL0384	19371	Bedford, ERF, Leyland	5	BL0888	19887	Ford	9
BL0374	19374	RENAULT TRUCKS	3	BL0889	19888	DAF	9
BL0411	19384	Foden, Fruehauf, Iveco, Meritor,	5	BL0890	19889	DAF	9
BL0393	19393	SCANIA	3	BL0891	19890	Bova, DAF	10
BL0449	19411		5	BL0914	19891	Bova, DAF	10
BL0450	19449	HANOMAG	5	BL0892	19892	SAE, SAF	4
BL0451	19450	HANOMAG	5	BL0893	19893	SAE, SAF	4
BL0466	19451	RENAULT TRUCKS TRK	5	BL0896	19896	Foden, Ikarus, Mercedes-Benz,	4
BL0467	19466	Mercedes-Benz, Neoplan	5	BL0900	19900	DAF	4
BL0468	19467	Volvo	6	BL0901	19901	DAF	4
BL0479	19468	Volvo	6	BL0915	19914	DAF 95 FA 95.310, DAF FTG, DAF FTT	10
BL0477	19477	SAUER / SAF	3		19915	DAF 95 FA 95.310, DAF FTG, DAF FTT	
BL0478	19478	SAUER / SAF	3	BL0919	19919	RENAULT G G 230.19T	4
BL0480	19479	SAF	6	BL0931	19931	NISSAN UD	4
BL0490	19480	SAF	6	BL0932	19932	SCANIA	4
BL0486	19486	M.A.N., MERCEDES BENZ	3	BL0933	19933	Scania	4
BL0487	19487	M.A.N., MERCEDES BENZ	3	BL0934	19934	R.V.I (f)	4
BL0488	19488	M.A.N., MERCEDES BENZ	3	BL0935	19935	RENAULT, R.V.I	4
BL0491	19490	SAF	6	BL0938	19938	VOLVO	4
BL0494	19491	SAF	6	BL0939	19939	VOLVO	4
BL0495	19494	Mercedes-Benz, Van Hool	6	BL0940	19940	VOLVO	4
BL0496	19495	Fruehauf, Renault	6	BL0941	19941	VOLVO	4
BL0505	19496	MAN, Mercedes-Benz, Steyr	6	BL0845	19844 20	Mercedes-Benz	9
BL0517	19505	Mercedes-Benz	6	BL0847	19845 20	Mercedes-Benz	9
BL0518	19517	SAF, Trailor	6	BL0001		M.I.T. Canter	1
BL0553	19518	SAF, Trailor	6	BL0002		NISSAN UD	1
BL0555	19553	ERF, Iveco, Meritor	6	BL0003		NISSAN UD	1
BL0554	19554	E.R.F, IVECO, R.O.R, (MERITOR) AXLE ROCK	3	BL0004		TATA	1
BL0557	19555	Iveco, Meritor, Rockwell	6	BL0005		TATA	1
BL0556	19556	IVECO, R.O.R, (MERITOR) AXLE ROCK WELL	3	BL0006		TATA	1
BL0558	19557	Foden, Fruehauf, SAE, SAF, SMB, Trailor	6	BL0007		TATA	1
BL0559	19558	SETRA SERIES 200 S 200	6	BL0008			1
BL0569	19559	SETRA SERIES 200 S 200	6	BL0009			1
BL0560	19560	VOLVO	3	BL0010			1
BL0561	19561	VOLVO	3	BL0011			1
BL0562	19562	VOLVO	3	BL0012			1
BL0563	19563	VOLVO	3	BL0013			1
BL0573	19569	RENAULTS TRUCKS	7				
BL0579	19573	BPW	7				
BL0574	19574	Peltz Axle, Cardi Axle, BPW Axle	3				

SI No.	REPLACEMENT To.			APPLICATION	IDL	WIDTH	THICKNESS	IR	HOLE	RIVETS
	BFMC /	WVA. /	E Mark no.				 A/B			
BL0001	M.I.T.Canter			M.I.T.Canter	323	74.5	18.5	152	12	8x15
BL0002	NN/CB/31/R			NISSAN UD	198	151	15	194	14	L-9
BL0003	NN/CB/31F			NISSAN UD	198	220	14	194	15	L-9
BL0004	TATA1313 R			TATA	211	150	14.85	191.6	8	
BL0005	TATA1313F			TATA	211	100	10.35	191.6	8	
BL0006	TZ/1/1			TATA	210	120	14.15	191.6	8	
BL0007	TZ/2/1			TATA	210	150	14.15	191.6	8	
BL0008	MB-162517 IG				323	74.5	10	152	12	
BL0009	MB-162517				323	74.5	8	152	UD	
BL0010	MB-162517				323	74.5	10	152	UD	
BL0011	MB-162517				323	74.5	8	152	12	
BL0012	MF/515/F				186	152.5	15	194	12	
BL0013	MF/515/R				198	117	15	194	10	
BL0030	RW/34/1	19030	E11 90R-02801229/27011	R.O.R. (MERITOR)	189	178	22.4 / 18.1	209	12	L-9
BL0032	BC/36/1	19032	E9 90R-02801223/23	MERCEDES BENZ	204	180	17.8/11.0	205	10	8 X 20
BL0033	BC/97/1	19033	E11 90R-02801229/27011	Bergische Achsen (B.P.W)	195.1	177.8	21.6/11.0	205	10	8x20
BL0036	IL/66/1	19036	E11 90R-02801229/27011	BODEN, CARRIMORE, FRUEHAUF	189	178	18.2/14.3	203	12	10X10

SI No.	REPLACEMENT To.			APPLICATION	IDL	WIDTH	THICKNESS	IR	HOLE	RIVETS
	BFMC /	WVA. /	E Mark no.							
BL0037	IL/67/1	19037	E11 90R-02B01229/2 7011	FRESCO, HANDS, HIGHWAY, YORK	194	178	18.1/9.6	203	12	10X10
BL0059	MB/48/2	17059		MerCEDES BENZ, Bussing, Tata	212	100	10	194	8	
BL0075	SV/8/1	19075	E11 90R-02B01229/2 6995	SCANIA	192.6	178	19	213	12	L-12
BL0094	BC/37/1	19094	E9 90R-02B1223/10 73	KASSBOHRER / MERRIWORTH TRAILERS	204	200	17.8/11.0	205	10	8 X 20
BL0150	BC/62/63/1	15150		IVECO STEYR	252	80	7	155	12	6x18
BL0151	DF/21/1	19151	E11 90R-02B01229/2 7010	D.A.F	218	152	18.6/14.01	203	10	L9
BL0160	MB/51/1	19160		MERCEDES BENZ	187	170	15	205	8	8 X 20
BL0161	SV/26/1	17161		SCANIA	213	127	19	213	8	L-12
BL0174	BC/62/63/1	15174		IVECO STEYR	344	80	7	155	16	6x18
BL0187	RN/104/1	19187		RENAULT, R.V.I	184.3	220	18.5	189	8	8x18
BL0245	SY/23/1	19245	E11 90R-02B01229/2 7010	Steyr puch (Daimler)	185.7	160	15	195	8	8x18
BL0246	SY/24/1	19246	E11 90R-02B01229/2 7011	Steyr puch (Daimler)	185.7	185	15	195	8	10x18
BL0276	MB/60/1	17276	E11 90R-02B01229/2 7014	MERCEDES BENZ	177	140	15	200	8	8x20
BL0283	SJ/28/1	19283	E11 90R-02B01229/2 7011	SAUER / SAF	188.9	178	20.3/16.6	209	8	8x20
BL0284	SJ/29/1	19284	E11 90R-02B01229/2 7011	SAUER / SAF	194.4	178	20.2 / 11.6	209	8	8x20
BL0297	MB/67	19297		MERCEDES BENZ	210	100	15	194	8	8x15
BL0369	FU/5/1	19369	E11 90R-02B01229/2 7013	BODEN TRAILER	194	219	18.1/9.6	203	12	L10

SI No.	REPLACEMENT To.			APPLICATION	IDL	WIDTH	THICKNESS	IR	HOLE	RIVETS
	BFMC /	WVA. /	E Mark no.							
BL0370	FU/4/1	19370	E11 90R-02B01229/27013	BODEN TRAILAR	189	219	18.2/14.3	203	12	L10
BL0374	SA/11/1	19374	E11 90R-02B01229/26972	RENAULT TRUCKS	305	150	13	193	22	
BL0393	SV/27/1	19393	E11 90R-02B01229/26973	SCANIA	193	203	19	187	12	L12
BL0477	SJ/30/1	19477		SAUER / SAF	188.9	203	20.3 / 16.6	209	8	8x20
BL0478	SJ/31/1	19478		SAUER / SAF	194.4	203	20.2 / 11.6	209	8	8x20
BL0486	MP/31/1	19486	E9 90R-02B1223/1102	M.A.N., MERCEDES BENZ	178	160	17.3/12.1	200	8	8 X 18
BL0487	MP/32/1	19487	E9 90R-02B1223/2282	M.A.N., MERCEDES BENZ	178	180	17.3/12.1	200	8	8 X 18
BL0488	MP/36/1	19488	E9 90R-02B1223/1101	M.A.N., MERCEDES BENZ	178	220	17.3/12.1	200	8	8 X 18
BL0554	RW/29/1	19554		E.R.F, IVECO, R.O.R, (MERITOR) AXLE ROCK WELL	197	200	21.2 / 12.5	205	12	8x15
BL0556	RW/28/1	19556	E11 90R-02B01229/26995	IVECO, R.O.R, (MERITOR) AXLE ROCK WELL	197	180	20.9 / 13.75	205	12	8x15
BL0560	VL/74/1	19560	E11 90R-02B01229/26972	VOLVO	200	152	19.0/11.7	203	10	L11
BL0561	VL/75/1	19561	E11 90R-02B01229/26972	VOLVO	160	152	19.0/14.8	203	10	L11
BL0562	VL/76/1	19562		VOLVO	192	203	18.5/11.7	191.26	12	L-11
BL0563	VL/77/1	19563		VOLVO	187	203	18.5/14.80	191.26	9	L-11
BL0574	BC/80	19574		Peitz Axle,Cardi Axle,BPW Axle	162	200	17.5/10.6	146	8	8x18
BL0683	MP/30/1	17683	E11 90R-02B01229/26998	M.A.N., MERCEDES BENZ	178	140	17.3/12.1	200	8	8 X 18
BL0814	NN/41/1	19814		NISSAN UD	214	180	18	205	14	L-9

SI No.	REPLACEMENT To.			APPLICATION	IDL	WIDTH	THICKNESS	IR	HOLE	RIVETS
	BFMC /	WVA. /	E Mark no.				 A/B			
BL0892	SJ/26/1	19892		SAE, SAF	200	159.6	18.5	355	10	8x18
BL0893	SJ/27/1	19893		SAE, SAF	200	168	18.6	355	10	8x18
BL0896	AX/14/6	19896		Foden, Ikarus, Mercedes-Benz,	177.8	196.2	18.6	419	14	10-8
BL0900	DF/34/1	19900	E11 90R- 02B01229/2 7010	DAF	193	150	19.2/16.9	203	8	L-10
BL0901	DF/35/1	19901	E11 90R- 02B01229/2 7010	DAF	195	150	18.6/12.9	203	8	L-10
BL0919	SV/37/1	19919	E11 90R- 02B01229/2 6972	RENAULT G G 230.19/T	370	150	13.5	193.5	18	8 x 18
BL0931	NN/40/1	19931	E11 90R- 02B01229/2 6995	NISSAN UD	235	178	19	200	6	L-9
BL0932	SV/41/1	19932	E9 90R- 02B1223/26 86	SCANIA	235	203	19	187	16	L12
BL0933	SV/42	19933	E9 90R- 02B1223/27 69	Scania	235	254	19	187	16	L-12
BL0934	RN/100/1	19934	E11 90R- 02B01229/2 6972	R.V.I (R)	187	150	18.5	189	8	8 X 18
BL0935	RN/101/1	19935	E11 90R- 02B01229/2 6995	RENAULT, R.V.I	185.4	175	18.5	187	8	8 X 18
BL0938	VL/87/1	19938	E11 90R- 02B01229/2 6995	VOLVO	177	175	18.3/12.6	200	12	L9
BL0939	VL/88/1	19939	E11 90R- 02B01229/2 6973	VOLVO	177	200	18.3/12.6	200	12	L9
BL0940	VL/89/1	19940		VOLVO	177	225	18.3/12.6	200	12	L9
BL0941	VL/86/1	19941	E11 90R- 02B01229/2 6972	VOLVO	177	150	18.3 / 12.5	200	12	L9
BL1032	BC/98/1	19032	E9 90R- 02B1223/23 23	Styler,B.P.W Axle,Cardi, Warstein	205	180	17.4,10.7	205	10	8x20
BL1033	RW/35/1	19033	E11 90R- 02B01229/2 7011	R.O.R. (MERITOR)	194	178	21.8 / 13.3	209	12	L-9

SI No.	REPLACEMENT To.			APPLICATION	IDL	WIDTH	THICKNESS	OD	HOLE	RIVETS
	BFMC /	WVA. /	E Mark no.				 A/B		 #	
BL0112		19112		Mercedes-Benz	200	130.5	15.5	364	6	8x12
BL0121	BC/46/1	19121	E11 90R-02B01229/2 7011	BPW 420 X 180	191	180	18	420	10	
BL0185	SV/7/1	19185	E11 90R-02B01229/2 6995	MAN 13215	193	90	19	412	6	
BL0200	BC/35/1	19200	E11 90R-02B01229/2 7010	BPW, Cardi, Fruehauf, SAE, SAF	160	203.9	17.8	420	10	8x15
BL0256	DF/16/2	19256	E11 90R-02B01229/2 7011	Bova, DAF, Neoplan	178	212.4	18.5	419	14	10-10
BL0260	DF/17/2	19260	E11 90R-02B01229/2 7011	Bova, DAF, Neoplan	178	217.5	18.6	419	14	10-10
BL0351	GG/140	19351		Bedford, Ford, Renault	152.4	320	12.7	394	12	L-9
BL0365	RW/1/3	19365	E11 90R-02B01229/2 7012	Fruehauf, Meritor	203.2	194.6	18.1	419	12	5x16
BL0366	RW/2/3	19366	E11 90R-02B01229/2 7012	Fruehauf, Meritor	203.2	189.1	18.2	419	12	5x16
BL0371	GG/142/1	19371		Bedford, ERF, Leyland	203.2	358.4	12.7	394	18	
BL0384	CW/4/1	19384		Foden, Fruehauf, Iveco, Meritor,	177.8	189.1	18.6	381	12	10-10
BL0411		19411			160	186.2	16	420	8	
BL0449	HJ/20/1	19449	E11 90R-02B01229/2 7011	HANOMAG	195	180	19	420	8	
BL0450	HJ/21/1	19450	E11 90R-02B01229/2 7011	HANOMAG	191	180	19	420	8	
BL0451	BT/59/1	19451	E11 90R-02B01229/2 6995	RENAULT TRUCKS TRK	370.5	175	14	414	16	
BL0466	MB/58/3	19466		Mercedes-Benz, Neoplan	220	155.5	19.2	408	10	8x15
BL0467	VL/72/1	19467		Volvo	177.8	192	19	394	12	L-12

SI No.	REPLACEMENT To.			APPLICATION	IDL	WIDTH	THICKNESS	OD	HOLE	RIVETS
	BFMC /	WVA. /	E Mark no.				 A/B			
BL0468	VL/73/1	19468		Volvo	177.8	147	19	394	9	L-12
BL0479	SJ/32/1	19479		SAF	180	170.3	20.8	367	8	8x18
BL0480	SJ/33/1	19480		SAF	180	170.3	20.7	367	8	8x18
BL0490	SJ/34/1	19490		SAF	200	170.3	20.8	367	8	8x15
BL0491	SJ/35/1	19491		SAF	200	170.3	20.7	367	8	8x15
BL0494	MP/31/2	19494		Mercedes-Benz, Van Hool	160	178	17.3	410	8	8x20
BL0495	MP/32/2	19495		Fruehauf, Renault	160	178	17.3	410	8	8x18
BL0496	MP/36/2	19496	E11 90R-02801229/2 6975	MAN, Mercedes-Benz, Steyr	223	178	17.3	410	8	8x20
BL0505	MB/120/2	19505		Mercedes-Benz	200	173.6	15.5	364	8	8x12
BL0517	SJ/24/1	19517		SAF, Tractor	150	129.1	15.6	300	8	8x18
BL0518	SJ/25/1	19518		SAF, Tractor	150	131.7	15.7	300	8	8x18
BL0553	RW/29/1	19553	E11 90R-02801229/2 6973	ERF, Iveco, Meritor	199.6	196.4	21.2	410	12	8x15
BL0555	RW/28/1	19555	E11 90R-02801229/2 6995	Iveco, Meritor, Rockwell	180	196.4	21.2	410	12	8x15
BL0557	FT/6/1	19557	E11 90R-02801229/2 7012	Foden, Fruehauf, SAE, SAF, SMB, Tractor	203.2	194.6	18.1	419	16	5x16
BL0558	PB/11/1	19558	E11 90R-02801229/2 6995	SETRA SERIES 200 S 200	207	180	15.9	410	8	10x18
BL0559	PB/10/1	19559	E11 90R-02801229/2 6995	SETRA SERIES 200 S 200	211	180	15.8	410	8	10x18
BL0569	BT/59/4	19569	E11 90R-02801229/2 6995	RENAULTS TRUCKS	370.5	175	14	414	14	

SI No.	REPLACEMENT To.			APPLICATION	IDL	WIDTH	THICKNESS	OD	HOLE	RIVETS
	BFMC /	WVA. /	E Mark no.				 A/B			
BL0573	BC/79/1	19573		BPW	150	145.4	17.5	300	8	8x18
BL0579	MB/74/1	19579	E11 90R-02801229/2 7005	Bova, MAN, Mercedes-Benz, Neoplan	160	217.1	17.7	410	10	8x20
BL0580	MB/75/1	19580	E11 90R-02801229/2 7005	Bova, MAN, Mercedes-Benz, Neoplan	160	173.7	17.6	410	8	8x20
BL0581	MB/76/1	19581	E11 90R-02801229/2 6975	Bova, MAN, Mercedes-Benz, Neoplan	220	217.1	17.7	410	10	8x20
BL0582	MB/77/1	19582	E11 90R-02801229/2 6975	Bova, MAN, Mercedes-Benz, Neoplan	220	173.7	17.6	410	8	8x20
BL0591	BC/81/1	19591		BPW	220	203.9	17.8	420	10	8x15
BL0604	RW/9/3	19604		Fruehauf, Meritor	190.5	126.6	15.7	311	10	L-10
BL0605	RW/13/3	19605		Fruehauf, Meritor	190.5	159.2	15.5	311	10	L-10
BL0606	FT/7/1	19606	E11 90R-02801229/2 7012	Foden, Fruehauf, SAE, SAF, SMB, Trailor	203.2	189.1	18.2	419	16	5x15
BL0613	FT/11/1	19613	E11 90R-02801229/2 7011	Fruehauf, SMB,Trailor	177.8	194.6	19.4	419	16	5x15
BL0614	FT/12/1	19614	E11 90R-02801229/2 7011	Fruehauf, SMB,Trailor	177.8	189.1	19.5	419	16	5x15
BL0617	DF/30/1	19617	E11 90R-02801229/2 7012	DAF F2800, DAF F3300, DAF F3600	210	203.2	18.5	420	16	L-10
BL0618	DF/31/1	19618	E11 90R-02801229/2 7012	DAF F2800, DAF F3300, DAF F3600	219	203.2	18.5	420	16	L-10
BL0632	MB/84/1	19632	E11 90R-02801229/2 6995	Mercedes-Benz	180	173.7	17.7	410	8	8x18
BL0633	MB/85/1	19633	E11 90R-02801229/2 6995	Mercedes-Benz	180	217.1	17.6	410	10	8x18
BL0694	FI/106/1	19694	E11 90R-02801229/2 7011	FIAT, IVECO LKW	197	180	12	420	16	8x20
BL0699	PB/18/1	19699	E11 90R-02801229/2 6975	BOVA FUTURA FHD, MERCE CONECTO, NEOPL CITYLINER,	196	220	17.3	110	12	10x18

All parts listed,sold or supplied are offerd and sold as parts for replacement only.Vehicle or manufacturer names,description, symbols and part numbers are used for reference pupose only


SI No.	REPLACEMENT To.			APPLICATION	IDL	WIDTH	THICKNESS	OD	HOLE	RIVETS
	BFMC /	WVA. /	E Mark no.				 A/B			
BL0714	RW/28/30/31/1	19714		Iveco	179.6	196.4	22	410	12	8x15
BL0716	RW/29/32/33/1	19716		ERF, Iveco, Meritor	199.6	196.4	22.1	410	12	8x15
BL0718	BC/120/1	19718		Fruehauf, Benalu, SMBF	200	169.05	20.68	360.9	8	5x16
BL0720		19720		Raba	160	195.3	21.7	400	10	10 - 10
BL0721		19721		Raba	160	195.3	21.8	400	10	10 - 10
BL0722		19722		Raba	180	195.3	21.7	420	16	L-10
BL0742	PB/10/1	17742	E11 90R-02B01229/2 6998	SETRA SERIES 300	207	140	16.8	410	8	10x20
BL0743	PB/9/1	17743	E11 90R-02B01229/2 6998	SETRA SERIES 300	210	140	16.8	410	8	10x20
BL0790	FT/15/1	19790		Fruehauf	177.8	189.1	18.3	419	12	5x16
BL0791	FT/16/1	19791		Fruehauf	177.8	194.6	18.3	419	12	5x16
BL0795	MB/83/1	17795	E11 90R-02B01229/2 6998	MERCE O 303	173.7	140	17.7	410	8	8x18
BL0796	MB/82/1	17796	E11 90R-02B01229/2 6998	MERCE O 303	217	140	17.6	410	10	8x18
BL0799	VL/81/1	19799		Volvo	254	147	19	394	12	L-10
BL07BLO	BC/121/1	19719		Fruehauf, Benalu, SMBF	200	169.05	20.62	360.9	8	5x16
BL0800	VL/82/1	19800		Volvo	254	192	19	394	9	L-10
BL0825		19825		Bergische Achsen (BPW), Warstein	220	203.94	17.8	420	10	
BL0844	MB/104/1	19844		Mercedes-Benz	160	130.5	13.5	360	6	8x15

SI No.	REPLACEMENT To.			APPLICATION	IDL	WIDTH	THICKNESS	OD	HOLE	RIVETS
	BFMC /	WVA. /	E Mark no.				 A/B			
BL0844 20	MB/113/1	19844 20		Mercedes-Benz	160	130.5	15.5	364	6	8x15
BL0845	MB/105/1	19845		Mercedes-Benz	160	173.5	13.5	360	8	8x15
BL0845 20	MB/114/1	19845 20		Mercedes-Benz	160	173.5	15.5	364	8	8x15
BL0847	PB/18/1	19847	E11 90R- 02801229/2 6975	Neoplan, Perrot, Setra, Van Hool	220	196	17.5	410	12	10x18
BL0848	PB/19/1	19848	E11 90R- 02801229/2 6975	Neoplan, Perrot, Setra, Van Hool	220	196	17.4	410	12	10x18
BL0849	PB/16/1	19849	E11 90R- 02801229/2 7005	Neoplan, Perrot, Setra	160	196	17.4	410	8	10x18
BL0850	PB/17/1	19850	E11 90R- 02801229/2 7005	Neoplan, Perrot, Setra	160	196	17.5	410	8	10x18
BL0877	PD/7/1	19877	E11 90R- 02801229/2 7005	PEGAS TRONER 1236.38T	160	160	16.2	410	13	6x15
BL0878	PD/8/1	19878	E11 90R- 02801229/2 7005	PEGAS TRONER 1236.38T	160	160	16.2	410	13	6x15
BL0879	PD/3/1	19879	E11 90R- 02801229/2 6973	PEGAS TRONER 1334 R	160	200	17.8	410	13	6x15
BL0881	PD/4/1	19881	E11 90R- 02801229/2 6973	PEGAS TRONER 1334 R	160	200	18.9	410	13	6x15
BL0885	VL/83/1	19885		Volvo	239.5	192	19	394	12	L-12
BL0886	VL/84/1	19886		Volvo	239.5	147	19	394	9	L-12
BL0887	CW/11/1	19887		Ford	177.8	195.6	19.5	394	16	L-8
BL0888	DF/36/1	19888	E11 90R- 02801229/2 7011	DAF	175	180.9	18.7	420	12	10-10
BL0889	DF/37/1	19889	E11 90R- 02801229/2 7011	DAF	175	177.4	18.8	420	12	10-10
BL0890	DF/32/1	19890	E11 90R- 02801229/2 7012	Bova, DAF	200	177.4	18.8	420	16	10-10

Sl No.	REPLACEMENT To.			APPLICATION	IDL	WIDTH	THICKNESS	OD	HOLE	RIVETS
	BFMC /	WVA. /	E Mark no.				 A/B			
BL0891	DF/33/1	19891	E11 90R-02B01229/2 7012	Bova, DAF	200	180.9	18.7	420	16	10-10
BL0914	DF/39/1	19914	E11 90R-02B01229/2 7013	DAF 95 FA 95.310, DAF FTG, DAF FTT	180.9	240	18.7	420	16	L-11
BL0915	DF/38/1	19915	E11 90R-02B01229/2 7013	DAF 95 FA 95.310, DAF FTG, DAF FTT	177.4	240	18.8	420	16	L-11



All parts listed,sold or supplied are offerd and sold as parts for replacement only.Vehicle or manufacturer names,description, symbols and part numbers are used for reference pupose only

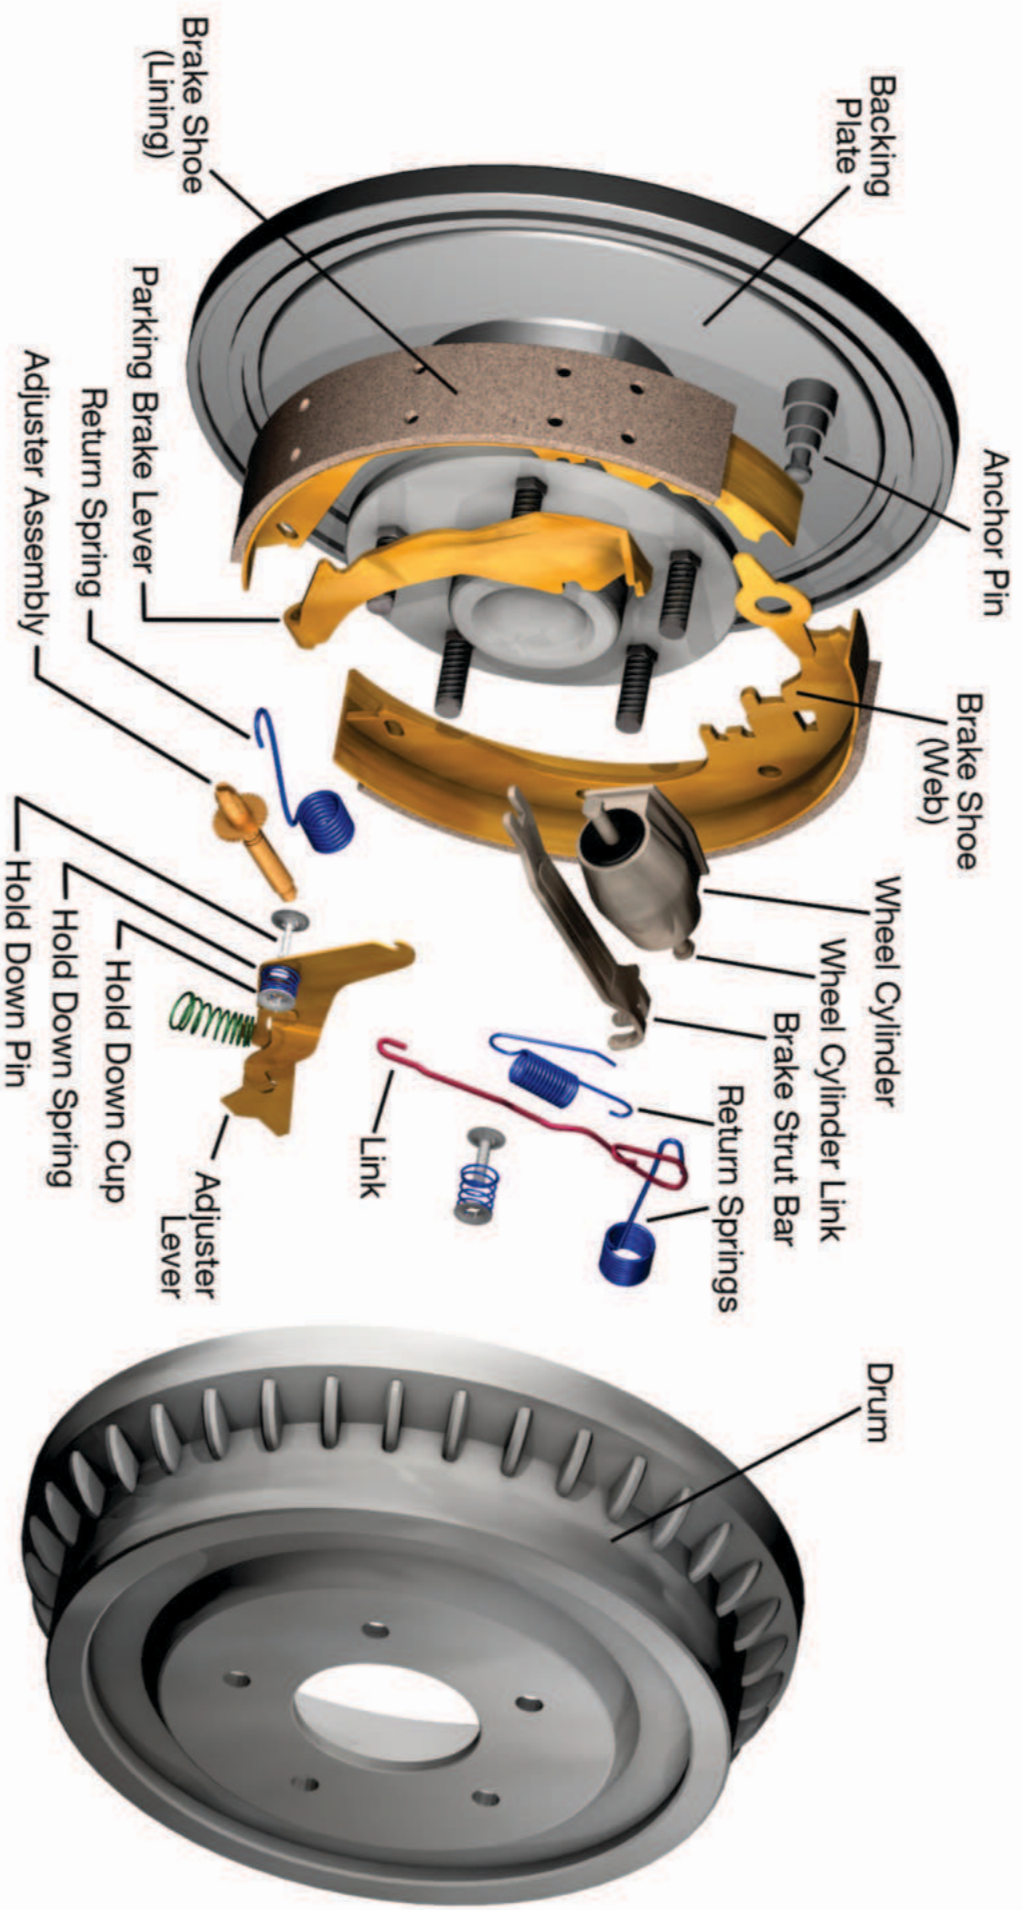



SURI INTERNATIONAL

A-69, WAZIR PUR INDUSTRIAL AREA, NEW DELHI-110 052, INDIA

TEL: 91-11-47557319, FAX" +91-11-27372158

MOBILE: 9810010714, 9811043151

E- mail: suriint@yahoo.com, Website: www.sp-groupindia.com

Disclaimer: We have obtained the information reflected in this catalogue from reliable sources and believe this information to be complete and accurate as of time of printing. Nevertheless, we do not make any warranty, express or implied, as to the correctness, accuracy, or completeness of this information, nor as to MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE in relation thereto. We specifically disclaim any responsibility or liability for any errors, omissions, changes, and updates in this information and for any resulting harm and shall not be liable for direct, incidental, or consequential damages resulting therefrom.

All parts listed, sold or supplied are offered and sold as parts for replacement only. Vehicle or manufacturers names, descriptions, symbols and numbers are used for reference purpose only.